

PROCESSOR TYPE PDP-11 Family

**M9680-D0001 CODE: F CS: A**  
OCT-73 - PROBLEM: Maintenance module time constant is too long. It can create NPR latency problems for other peripherals when running systems exerciser programs.  
CORRECTION: Reduce the value of capacitor C1 to 270 pfd to change the nominal time constant to 1.5 microseconds.  
In-plant effectivity -Rework all M9680's in-plant immediately.  
Field effectivity -Rework turn-around module to run diagnostics on any system with DR11-B and TM11.  
( Time To Install And Test .5 Hour. ) ( Kit Contents -F1073 -FCO/Prints And Parts )