



**PA611-P**  
Typesetting Punch  
Control

**PROCESSOR TYPE PDP-11 Family**

**PA611P-B0001 CODE: DF ML: C WL: A**  
AUG-73 - CORRECTION 1: Correct errors in the UNIBUS connector print.  
PROBLEM 2: M7821 modules are replacing M7820's and pin J1 is floating.  
CORRECTION 2: Connect pin J1 to BUS NPR L ; the only ADD/DELETE is A01S2 to B02J1, ADD . The addition of that wire affects all units with either M7820's or M7821's. However, in the field, the M7820 is not to be replaced with an M7821 unless, and until the M7820 fails.  
In-plant effectivity -03 immediately retrofit all production units which use M7821's.  
Field effectivity -Retrofit immediately all units which use M7821'S; retrofit at next PM all units which use M7820's.  
( Time To Install And Test .5 Hour. ) ( Kit Contents -F1024 -FCO/Prints )