

PROCESSOR TYPE PDP-11/05

VT40-00001 CODE: D DD: A
JAN-73 - PROBLEM: Setting up Production to handle sub-assemblies.
CORRECTION: Changed option drawings D-MD-7409978-0-0 and D-IA-7409768-0-0 for better service.
In-plant effectivity -02 phase-in

VT40-00002 CODE: P DD: B
JUL-73 - PROBLEM: Chassis tracks and hardware not called out.
CORRECTION: Added tracks and hardware to Parts List.
In-plant effectivity -06 -Documentation change only

VT40-D0003 CODE: F DD: C
AUG-73 - PROBLEM: Noise superimposed on A320 analog by UNIBUS cable routing over A320.
CORRECTION: Add electromagnetic shield #17-00021-00 to top of A320, thus shielding the A320 from the UNIBUS.
In-plant effectivity -03 * phase-in shield in production no later than December 1, 1973 and insert shield as required until then.
Field effectivity -Retrofit all GT40's
(Time To Install And Test .5 Hour.) (Kit Contents -F1022 -FCO/Prints And Parts)